

TenarisHydril Wedge 513[®] / 511[®] Connections

Scope

These guidelines apply specifically to the use of TenarisHydril Wedge 513[®] and Wedge 511[®] connections. This document should be used in conjunction with the TenarisHydril Running Manual which is the main document applicable for running all TenarisHydril premium connections.

References

- TenarisHydril Running Manual.
- Premium Connection Approved Thread Compounds TSH-MD-00.0002.
- Recommended guidelines for the field inspection of TenarisHydril connections, FSOG 13-005.
- Wedge 513[®] Handling Plugs TN 9906.
- Wedge 511[®] Handling Plugs TN 9710.

Equipment, Material & Documents

1. Verify the appropriate thread compound is available.
2. Refer to document TSH-MD-00.0002 for a list of compounds approved by Tenaris.

3. Latest version of the specific Product Data Sheet can be obtained from the Tenaris website. In case this is unavailable, request the data sheet from the local Technical Sales representative or contact-tenarishydril@tenaris.com.

Pre-Running




1. Never move or handle pipe without the correct thread protectors securely in place.
2. Ensure connections are clean and free of all debris and / or contaminants, cleaning methods employed should conform to the recommendations contained within the TenarisHydril Running Manual.
3. Verify the connections to be assembled are genuine TenarisHydril manufactured connections.
4. Visually inspect threads and seal areas prior to running, ensuring no damage is evident.
5. On Dopeless® connections check condition of both pin and box coating ensuring no peel off or degradation has occurred.
6. Verify compatibility of the 513® / 511® connection with any accessories such as pup joints, cross overs, cement heads etc.
7. Verify material grade of all accessories ensuring compatibility with main string.
8. Check availability of handling plugs, minimum of 3 to ensure efficiency of running process.
9. Check the handling plugs are in good condition and fit correctly onto pipe.

10. Check the handling plugs are genuine TenarisHydril threads.
11. Verify handling plug number and maximum lift capacity.
12. Never exceed the maximum lift capacity.
13. Ensure handling plug OD / weight is compatible with the pipe connections, Wedge 513® / 511® have limited same OD / weight interchange capability.
14. Refer to the TenarisHydril running manual for the care and use of handling / lift plugs.

Inspection

1. Inspection criteria for all Wedge Series 500™ connections is as outlined in the Field Service Operative Guideline FSOG 13-005.
2. Pay particular attention to seal areas of Wedge 513®.
3. Check box and pin for signs of mashes or deformation caused during transportation / handling.
4. Ensure there are no gouges, tears or raised material on seal saver area of Wedge 513®.

Wedge 513® Configuration

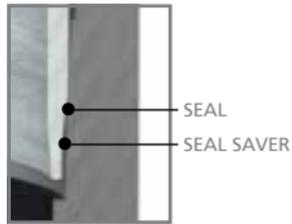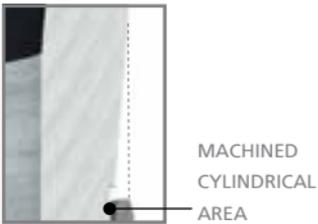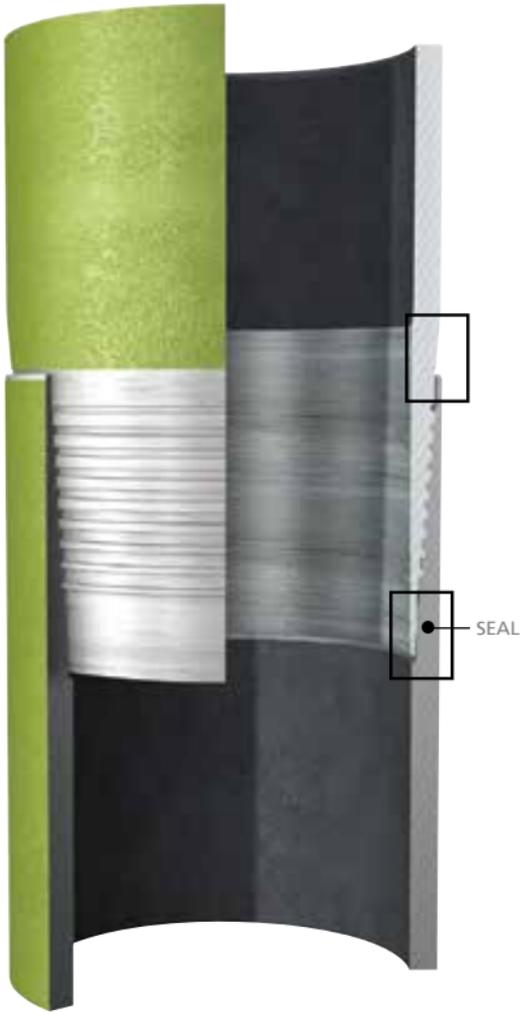


Wedge 511® Configuration

No metal to metal seal on Wedge 511®.



MACHINED
CYLINDRICAL
AREA

Thread Compound Application

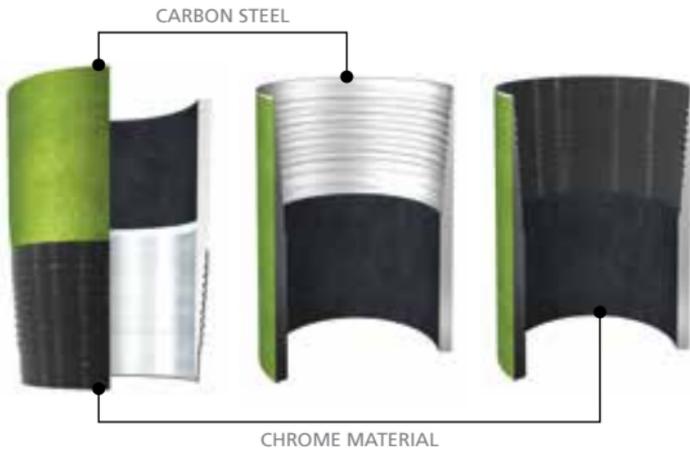


FOR CARBON STEEL PIPE

1. Apply a thin coating of thread compound on the full pin end only, threads, seal and pin nose, the thread form should be clearly visible.
2. Do not apply running compound to the box end.
3. Thread compound should be cleaned from the box of carbon steel if received 'rig ready'.

FOR CHROME MATERIAL PIPE

1. Apply a thin coating of thread compound on both pin and box ensuring all threads, seal and pin nose are completely covered.
2. Do not over dope the connections, a thin even layer covering all surfaces is adequate.


Thread Lock Application

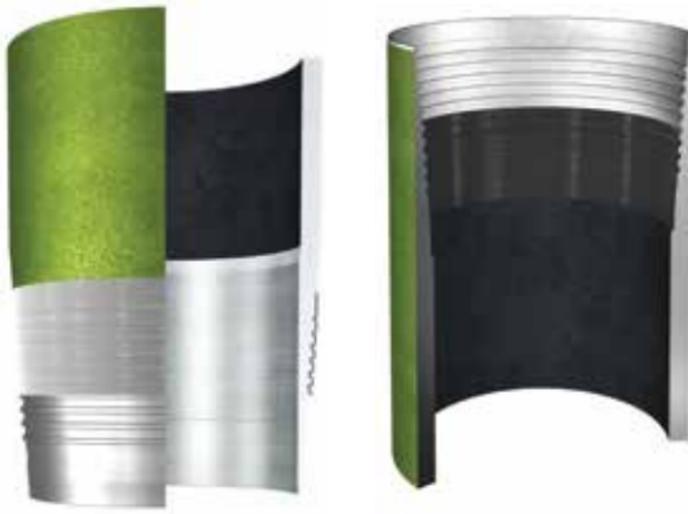

Connections must be clean and dry when applying thread lock.

1. Thread lock should be applied to 50% of the threads at the back of the pin connection.
2. Running compound should then be applied to the threads and seal at the back of the box connection.
3. When assembling standard non Dopeless® connections with thread lock use standard non Dopeless® torque values.

Wedge 513® / 511® Dopeless®

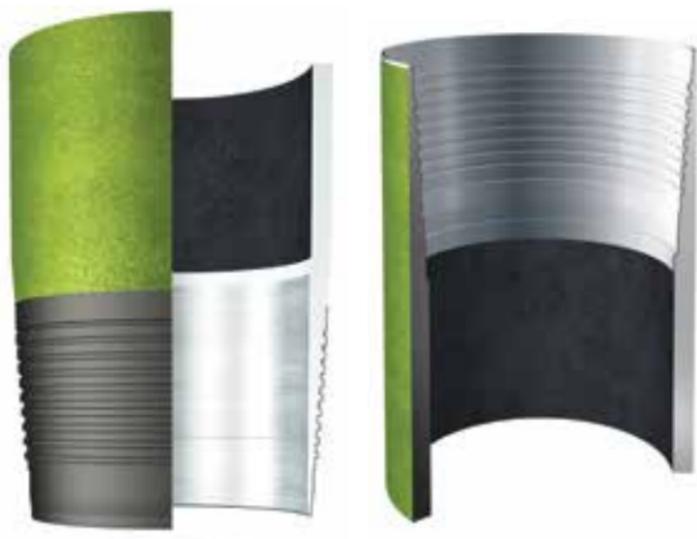

1. Minor rust or discolouring of the pin connection can be removed with the use of a clean, dry rag ensuring the Dopeless® coating remains intact.
2. Minor rust or discolouring of the box connection can be removed with the use of a non abrasive plastic scouring pad and a clean, dry rag ensuring the Dopeless® coating remains intact.
3. Dopeless® connections do not require the application of thread compound for make up.
4. If for whatever reason dope has to be applied to Dopeless® connections, whether both pin and box are Dopeless® or when mixing a standard connection with Dopeless®, apply thread compound as below:

NON DOPELESS® PIN INTO DOPELESS® BOX

- Apply a thin coating of thread compound on the full pin end, threads, seal and pin nose.
- Apply a thin coat of thread compound to box internal seal area.

DOPELESS® PIN INTO STANDARD BOX

- Apply a thin coating of thread compound on the pin end threads only.
- Do not dope pin seal or box connection.

DOPELESS® PIN INTO DOPELESS® BOX

- Apply a very thin layer of thread compound on the pin threads only.
- Do not dope pin seal or box connection.

	DOPELESS® PIN	STANDARD PIN
Standard Box	Dope Pin Threads Only	See page 6
Dopeless® Box	Dope Pin Threads Only	Dope Pin Threads & Seal. Dope Box Seal.

Wedge 513® / 511® Dopeless® Thread Lock

1. Ideally when running a Dopeless® string the connections to be thread locked should be the non Dopeless® variant with the connections cleaned of thread compound and completely dried, then thread lock and dope applied as per page 7.
2. When thread locking Dopeless® connections remove the Dopeless® coating from the threads on the pin connection where the thread lock is to be applied prior to the application of thread lock.
3. Leave the Dopeless® coating on the pin seal and threads where no thread lock is to be applied.
4. Dopeless® boxes should be washed with hot water then dried prior to thread locking.
5. Thread lock should be applied to 50% of the pin threads furthest from the pin nose, as per the diagram on page 7.
6. The application of thread compound is not required.
7. Do not apply thread lock to the seal area.

Torque Application

1. Set tong dump valve at optimum torque then test on pipe body.
2. For Dopeless® connections apply the specified torques as indicated on the TenarisHydril Dopeless® data sheet.

3. For doped connections, apply the specified torques indicated on the TenarisHydril standard variant data sheet.
4. Do not apply thread compound manufacturer's friction factor.
5. Standard doped variant, first connection make up;
 - Once optimum torque has been attained relax the tong and re-apply optimum torque.
 - If movement over ½" is witnessed re-apply optimum torque +20%.
 - Repeat process, checking to ensure no other factors are absorbing the applied torque.
 - Often the issue is caused by excessive application of thread compound.
 - Continue making up further joints applying higher torque if required.
 - Refer to the TenarisHydril Running Manual torque application section.
6. Double bump, (as above) every connection with an OD of 10 ¾" or larger.
7. For Dopeless® connections applying optimum torque twice (double bump) is not necessary.
8. When applying thread lock to standard doped connections, doped version torque values +20% should be used then double bump the connection.
9. When applying thread lock to Dopeless® connections, Dopeless® torque values +20% should be used then double bump the connection.

10. When any doped variant is made up to a Dopeless® connection apply the doped variant torque values. Double bump the connection as point 5.


11. When applying thread lock, doped version torque values +20% should be used, double bump the connection.


12. Computer make up equipment is not mandatory for Wedge 513® / 511® connections in carbon steel, but is recommended.

13. Computer make up equipment is strongly recommended for Wedge 513® / 511® connections in chrome steel.

14. Graph analysis for Wedge 513® / 511® connections is similar to that for all Wedge Series 500™, refer to the TenarisHydril Running Manual make up acceptance section for further explanation.

15. When computer equipment is used to monitor connection make up, the graph profiles should be similar to the ones below.

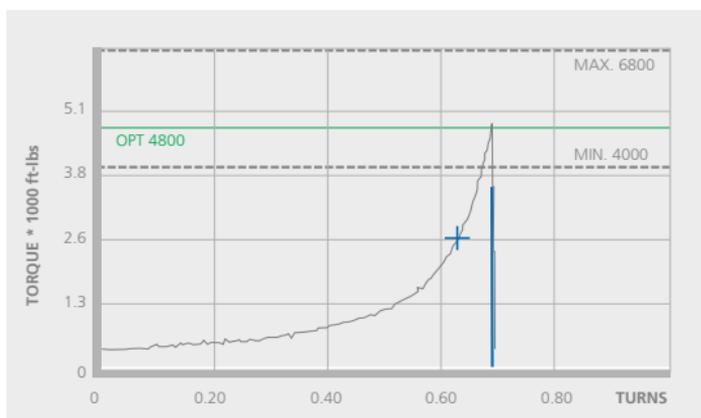

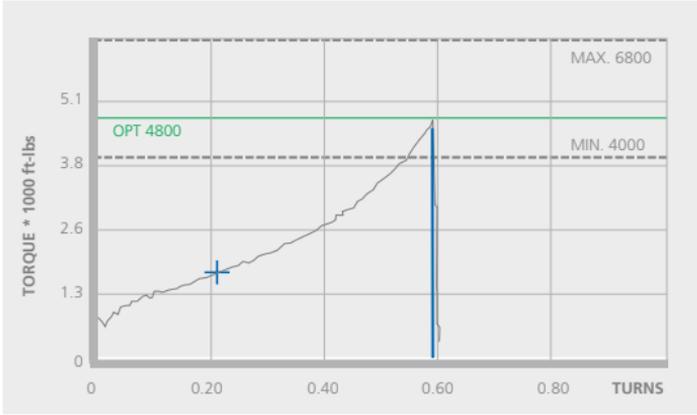

16. Wedge 513[®] connection has limited same size / weight interchange capability, if mixing weight / grade ensure compatibility of design and apply the higher torque value of the two connections.

17. Wedge 511[®] connection has limited same size / weight interchange capability, if mixing weight / grade ensure compatibility of design and apply the higher torque value of the two connections.

18. Wedge 513[®] and 511[®] connections are not interchangeable.

19. Wedge 513[®] and 523[®] connections are compatible in the same size / weight combination. For other weight combinations check the TenarisHydril premium connections catalogue.

Running

1. The use of a stabbing guide is strongly recommended.
2. The use of slip type elevators is strongly recommended.
3. The use of a safety clamp is strongly recommended when running Wedge 513® / 511® connections.
4. The use of a weight compensator is strongly recommended for chrome, large OD or heavy weight pipe.
5. To avoid cross threading, stab pipe in a smooth controlled fashion ensuring the pipe is vertical when doing so, continue to support and stabilise the pipe throughout the make up operation.
6. Upon commencement of initial rotation use low RPM (5 RPM or below) in order to ensure the pipe has not cross threaded during stabbing.
7. If cross threading is evident, immediately reverse rotate the pipe, completely disassemble, clean and inspect both connections.
8. Do not exceed 15 RPM during spin in.
9. Apply power tong at low RPM (do not exceed 5 RPM), for final make up.
10. Walk chrome pipe all the way in to hand tight, then apply tong only for final make up.
11. Ensure the back up tong is located below the box upset to prevent damage.
12. A factor which may preclude complete assembly is excessive thread compound applied to the connection, reduce the quantity applied if this is found to be the case.

Pulling

1. The use of a stabbing guide is strongly recommended to prevent hang up.
2. The use of a safety clamp is strongly recommended.
3. A single joint compensator is strongly recommended for chrome, large OD or heavy pipe.
4. Apply the back up tong jaw well below the box.
5. Apply power tong in low rpm (3-5 RPM) to break out the connection, ensuring the pipe is stabilised during the break and spin out process.
6. Do not exceed 15 RPM during spin out.
7. Walk chrome pipe all the way out by hand after initial break out.
8. Visual inspection is recommended to classify the thread condition, any rejected connections should be clearly marked and segregated for further investigation.
9. Apply clean, dry thread protectors after applying storage compound on clean, dry connections.
10. Storage / thread compound should always be applied to connections post job, even rejects.
11. Do not apply storage compound to Dopeless® connections.
12. For long term storage of Dopeless® connections, refurbishment by qualified personnel is recommended.
13. Ensure clean, dry, Dopeless® protectors with seal rings correctly in place are installed.